RISO INC. TECHNICAL INFORMATION BULLETIN

Subject: Vertical black dotted lines | Bulletin No: 44

☐ Factory Modification ☐ Field Modification ☐ Safety Information ■ Technical Information ☐ General Information ☐ Adv. Tech Information	Applies to: 2500 2700 3500	Modification Schedule: ☐ TBS ☐ Next Call ☐ Next PM ■ As Necessary	Factory Installed _____ Field Installed _____ Fitting TIme _____

Description: Setting plate is positioned so high that the protector of the thermal head presses the setting plate down which damages the master by the rough surface of the setting and load rollers.

Solution: Lower the setting plate by turning the adjustment screw on the handle of the setting plate.

Caution: Do not overadjust or it will result in master feeding problems in confidential master making.

[Black dot-lines on a printed copy]

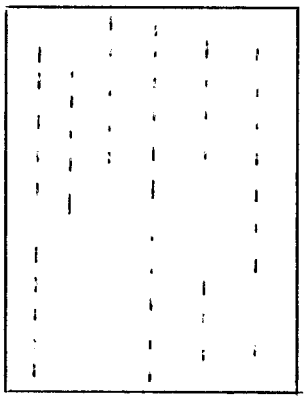

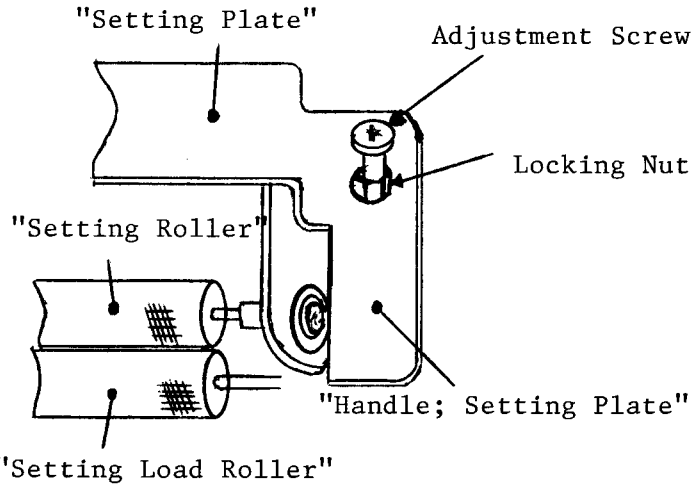

Issue Date	Effective Date	Supersedes Bulletin	Date	Page No. 1 of :
4/20/89	4/20/89		4/20/89	1